



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

(4)

D407-667-205TRN
Job Sheet 189279

**Part No:** D407-667-205TRN**Job Qty:** 1 pcs**Part Name:** Crosstube Turning Detail**Part Weight:** 0 lbs**Status:** New**Priority:** Medium**Job Created:** 1/22/19**Job Tracking No:****Due Date:** 2/8/19**Created By:** Jesse White**Type:** Stock**Description:**

Note: DWG REV G IPP Rev:A 08-03-06 new issue DD verified by:ec IPP Rev B 08.04.02 Removed polish EC
verified by: DD IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

Ship Via:**Bill of Materials****Job Routing**

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		DAS Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
100	Mori Seiki TL-40 - 1	1 pcs	2/8/19	2/8/19	2.49	3.20	Mori Seiki TL-40 - 1		DAS 66 2019-02-04
110	QC 2	1 pcs	2/8/19	2/8/19	0.00	0.00	QC 2 - 1		9-89
							QC 2 - 12		
							QC 2 - 14		
							QC 2 - 17		
							QC 2 - 19		
							QC 2 - 2		
							QC 2 - 20		
							QC 2 - 22		
							QC 2 - 23		
							QC 2 - 25		
							QC 2 - 32		
							QC 2 - 33		
							QC 2 - 35		
							QC 2 - 38		
							QC 2 - 39		
							QC 2 - 4		
							QC 2 - 40		
							QC 2 - 44		
							QC 2 - 45		
							QC 2 - 48		
							QC 2 - 49		
							QC 2 - 50		
							QC 2 - 51		
							QC 2 - 52		
							QC 2 - 54		
							QC 2 - 56		
							QC 2 - 57		
							QC 2 - 62		
							QC 2 - 63		

QC 2-66
DAS 66
9-89
2019-02-04
Scrap
done
mid

Plex 1/22/19 10:58 AM dart.white.jesse

P.T.O.

Entered: _____ Date: _____

WORK ORDER NON-CONFORMANCE / ROUTE UPDATE



NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☒	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☒ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐						
Date : 19/2/12		Sequence #: 140		QTY Affected : 1		MRB (QSI042) INSP 12 ✓ 19/2/12		
Description Work Order Deviation Well thickness measurement is over tolerance. Well up to 0.045" below nominal. However, mean thickness is above tolerance.				Disposition Acceptable. Ensure tube is marked so that thin wall is on neutral axis when bent (i.e. positioned so that thin wall is up/down in bender).				Completed By JW 19-7-22 Lead hand / Supervisor JW 19-7-22 QC / QA Coordinator DAS 68 9-89 JUL 22 2019
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☒ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☒ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread						
		Other/Details: _____						

				QC 2 - 8	DAS					
120	Mori Seiki TL-40 - 1 - B4B	1 pcs	2/8/19	0.00 0.00	Mori Seiki TL-40 - 1 - B4B	66 2019-02-05				
130	QC 2	1 pcs	2/8/19	0.00 0.00	QC 2 - 1	9-89				
QC 2-66 DAS 66 9-89 2019-02-05				QC 2 - 12						
				QC 2 - 14						
				QC 2 - 17						
				QC 2 - 19						
				QC 2 - 2						
				QC 2 - 20						
				QC 2 - 22						
				QC 2 - 23						
				QC 2 - 25						
				QC 2 - 32						
				QC 2 - 33						
				QC 2 - 35						
				QC 2 - 38						
				QC 2 - 39						
				QC 2 - 4						
				QC 2 - 40						
				QC 2 - 44						
				QC 2 - 45						
				QC 2 - 48						
				QC 2 - 49						
				QC 2 - 50						
				QC 2 - 51						
				QC 2 - 52						
				QC 2 - 54						
				QC 2 - 56						
QC 2 - 57										
QC 2 - 62										
QC 2 - 63										
QC 2 - 8										
140	QC 8	1 pcs	2/8/19	0.00 0.00	QC 8 - 12					
				QC 8 - 14						
				QC 8 - 17						
				QC 8 - 20						
				QC 8 - 25						
				QC 8 - 3						
				QC 8 - 32						
				QC 8 - 33						
				QC 8 - 35						
				QC 8 - 38						
				QC 8 - 39						
				QC 8 - 4						
				QC 8 - 44						
				QC 8 - 45						
				QC 8 - 49						
				QC 8 - 58						
				QC 8 - 8						
				QC 8 - 9						
				QC 8 - 68						
				QC 8 - 67						
				QC 8 - 1 (A)	DAS 67 9-89 19-02-20					
				145	Crosstubes - 2 - B4B	1 pcs	2/8/19	0.00 0.65	Crosstubes - 1 - B4B	
								Crosstubes - 2 - B4B	GP 19-02-20	
								Crosstubes - 3 - B4B		
								Crosstubes - 4 - B4B		
								Crosstubes - 5 - B4B		
Crosstubes - 6 - B4B										

Plex 1/22/19 10:58 AM dart.white.jesse

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

150	Crosstubes - 3 - B4B	1 pcs	2/8/19	0.00 0.25	Crosstubes - 1 - B4B	DR 19/02/25
					Crosstubes - 2 - B4B	
					Crosstubes - 3 - B4B	
					Crosstubes - 4 - B4B	
					Crosstubes - 5 - B4B	
					Crosstubes - 6 - B4B	
160	QC 7	1 pcs	2/8/19	0.00 0.00	QC 7 - 10	
					QC 7 - 13	
					QC 7 - 14	
					QC 7 - 15	
					QC 7 - 17	
					QC 7 - 18	
					QC 7 - 19	
					QC 7 - 2	
					QC 7 - 28	
					QC 7 - 3	
					QC 7 - 30	
					QC 7 - 34	
					QC 7 - 36	
					QC 7 - 37	
					QC 7 - 38	
					QC 7 - 41	
					QC 7 - 47	
					QC 7 - 48	
					QC 7 - 51	
					QC 7 - 58	
					QC 7 - 59	
					QC 7 - 6	
					QC 7 - 60	
					QC 7 - 9	
					QC 7 - 68	
					QC 7 - 50	DAS
					QC 7 - 67	67 19-03-11
170	Packaging 3-1 - Stock - B4B	1 pcs	2/8/19	0.00 0.00	Packaging 3 - 1 - B4B	9-89
					Packaging 3 - 2 - B4B	
					Packaging 3 - 3 - B4B	
					Packaging 3 - 4 - B4B	
					Packaging 3 - 5 - B4B	
					Packaging 3 - 6 - B4B	
					Packaging 3 - 7 - B4B	
					Packaging 3 - 8 - B4B	
					Packaging 3 - 9 - B4B	
					Packaging 3 - 10 - B4B	
					Packaging 3 - 11 - B4B	
					Packaging 3 - 12 - B4B	
					Packaging 3 - 13 - B4B	
					Packaging 3 - 14 - B4B	
					Packaging 3 - 15 - B4B	
					Packaging 3 - 16 - B4B	
					Packaging 3 - 17 - B4B	
					Packaging 3 - 18 - B4B	
					Packaging 3 - 19 - B4B	
					Packaging 3 - 20 - B4B	
					Packaging 3 - 21 - B4B	
					Packaging 3 - 22 - B4B	
					Packaging 3 - 23 - B4B	
					Packaging 3 - 24 - B4B	
					Packaging 3 - 25 - B4B	
					Packaging 3 - 26 - B4B	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

				Packaging 3 - 27 - B4B	
				Packaging 3 - 28 - B4B	
				Packaging 3 - 29 - B4B	
				Packaging 3 - 30 - B4B	
				Packaging 3 - 31 - B4B	
				Packaging 3 - 32 - B4B	
				Packaging 3 - 33 - B4B	
				Packaging 3 - 34 - B4B	
				Packaging 3 - 35 - B4B	
180 QC 21 - SA	1 pcs	2/8/19	0.00 0.00	QC 21 - SA - 21	
				QC 21 - SA - 70	

Part Op **100** - Mori Seiki CNC Lathe Large) 1-Fill tube with sand & install plugs DT8531 on both ends as per Folio FA248 3-Turn Descriptions: first side as per Folio FA248

110 - (QC2- Inspect parts off machine FAI/FAIB)

120 - (Mori Seiki CNC Lathe Large) 1-Turn second side as per Folio FA248 4-Scribe part # and batch # using vibrating stylus as per Dwg D407-667-245

130 - (QC2- Inspect parts off machine FAI/FAIB)

140 - (QC8- Inspect parts - second check)

145 - (Crosstubes) Grind off circumferential machining marks longitudinally.

150 - (Crosstubes) 1- handfinish X-TUBE INSIDE AND OUT 2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

160 - (QC7-Inspect Chemical Conversion Coat)

170 - Identify and stock in kanban rack

180 - (QC21- Final Inspection - Work Order Release)

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D6011-115	Crosstube Material	1 pcs (1 ea)	100-Mori Seiki TL-40 - 1	5006659

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
100-Mori Seiki TL-40 - 1	D6011-115	1	67	0

Part Specifications

Specifications could not be found.

Plex 1/22/19 10:58 AM dart.white.jesse



Container No: S150377



Part: D407 - 667 - 205TRN

Job No: 189279

Serial No/Batch: S150377

Revision: G

Inspector:

Exp Date:

Instructions:

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Date: 02/04/19

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

(4)

DART AEROSPACE LTD	Work Order: 189279
Description: Crosstube Assembly	Part Number: D407-667-245
Inspection Dwg: D407-667-245 Rev: G	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.495	✓		cnc-04	
	1.832	+0.005/-0.000	1.837	✓		cnc-08	
	1.838	+0.005/-0.000	1.843	✓		↓	
	1.892	+0.005/-0.000	1.897	✓			
	2.052	+0.005/-0.000	2.057	✓		cnc-04	
	2.206	+0.005/-0.000	2.210	✓		↓	
	2.521	+0.005/-0.000	2.525	✓		↓	
	2.633	+0.005/-0.000	2.637	✓			
	4.10	+/-0.030	4.090	✓		cnc-08	
	4.978	+/-0.030	4.986	✓		↓	
	2.040	+0.000/-0.010	2.036	✓		↓	
	0.125	+/-0.010	.128	✓		↓	
	R0.063	+/-0.010	.063	✓		RG	
	R0.500	+/-0.010	.500	✓		RG	
SIDE B	2.490	+0.005/-0.000	2.495	✓		cnc-04	
	1.832	+0.005/-0.000	1.837	✓		cnc-08	
	1.838	+0.005/-0.000	1.843	✓		↓	
	1.892	+0.005/-0.000	1.897	✓			
	2.052	+0.005/-0.000	2.057	✓		cnc-04	
	2.206	+0.005/-0.000	2.211	✓		↓	
	2.521	+0.005/-0.000	2.526	✓		↓	
	2.633	+0.005/-0.000	2.638	✓			
	4.10	+/-0.030	4.098	✓		cnc-08	
	4.978	+/-0.030	4.978	✓		↓	
	2.040	+0.000/-0.010	2.038	✓		↓	
	0.125	+/-0.010	.122	✓		↓	
	R0.063	+/-0.010	.063	✓		RG	
	R0.500	+/-0.010	.500	✓		RG	
	112.91	+/-0.020	112.900	✓		Tape	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

DART AEROSPACE LTD	Work Order: 189279
Description: Crosstube Assembly	Part Number: D407-667-245
Inspection Dwg: D407-667-245 Rev: G	Page 2 of 2

WALL THICKNESS MEASUREMENT

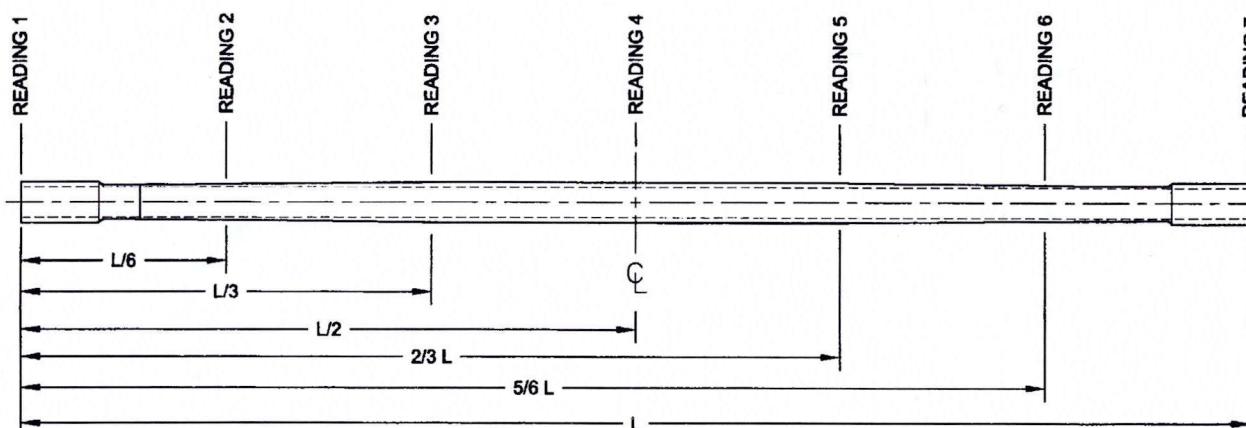

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	.231	.229	.227	.227	.004	0.075"
READING 2 L = 18.82	.271	.234	.262	.251	.041	
READING 3 L = 37.64	.373	.409	.455	.434	.082	
READING 4 L = 56.46	.617	.644	.686	.662	.069	
READING 5 L = 75.27	.368	.403	.457	.423	.089	
READING 6 L = 94.09	.200	.230	.277	.262	.077	
READING 7 L = 112.91	.230	.230	.229	.228	.002	

0.236
0.413 -0.040
0.413 -0.045
0.236 -0.036

Wall -0.045 ecc.

Calibration Result

Actual Block Thickness: 100-750

Sitescan 250 Measured Thickness: 100-750

Measured by:	DAS 66 9-89
Date:	2019-02-05

Audited by:	DAS 67 9-89
Date:	19-02-20

Preliminary Approval:	
Date:	

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	
F	12.06.04	Wall thickness form added	KJ	
G	15.05.14	Dwg Rev updated	KJ	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
03-08 17 DVE			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Item	QTY -245	PART NUMBER	DESCRIPTION
	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
1	1	D6011-115	CROSSTUBE
2	2	D2873-043	NUT PLATE
3	2	D2873-045	NUT PLATE
4	1	D2894-1	SUPPORT
5	2	D3190-1	CHAFING SHIELD
6	2	D3595-063-430	RUBBER CUSHION
7	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
8	4	MS21920-22	CLAMP
9	2	MS21920-25	CLAMP (OR MS21920-24)
10	AR	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
11	AR	PROSEAL 890	SEALANT

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT CROSSTUBE PER DART QSI 005 4.2
FOR HATCHED AREAS (ZN A6-2), MASK AS REQUIRED
TO APPLY PRIME AND APPLY CLEAR COAT ONLY
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 27.7 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1 CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEAL D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS 50 TO 70 DEGREES FROM BOTTOM OF CROSSTUBE OPPOSITE D2894-1 SUPPORT.
- TORQUE CLAMPS 80 TO 100 IN-LB. TORQUE CLAMPS ON D3190-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

RELEASED

2015 APR 09

47 ECN 15-557

G	INCORP. DEO's D407-667-245-F1/F2 (ZN D8-1, A8-1, D5-2, B6-2, C6-2); 8.90 WAS 8.53 (ZN D5-2); TORQUE REDUCED FOR CHAFING SHIELD (ZN A8-1); FINISH REVISED TO ALLOW MANUFAC. FLEXIBILITY (ZN C8-1)	RF	15.03.20
F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNABOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	47		
DRAWN	RF		
CHECKED	47		
MFG. APPR.	47		
APPROVED	47		
DE APPR.	47		
DATE	15.03.20		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D407-667-245 REV. G SHEET 1 OF 4 TITLE CROSSTUBE ASSY (407 HIGH AFT) SCALE NTS COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Entered: _____ Date: _____









WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

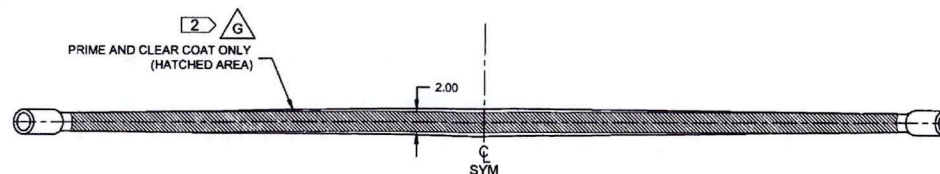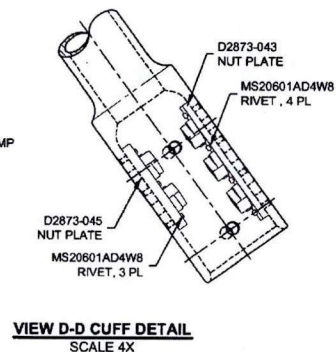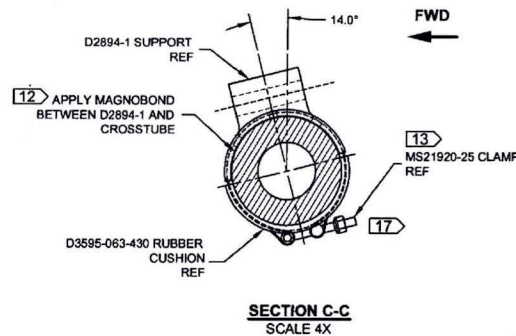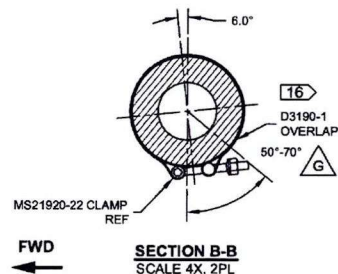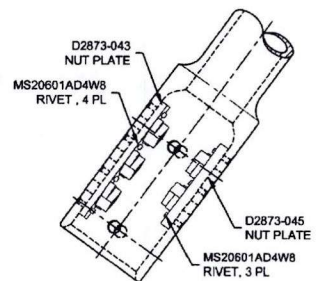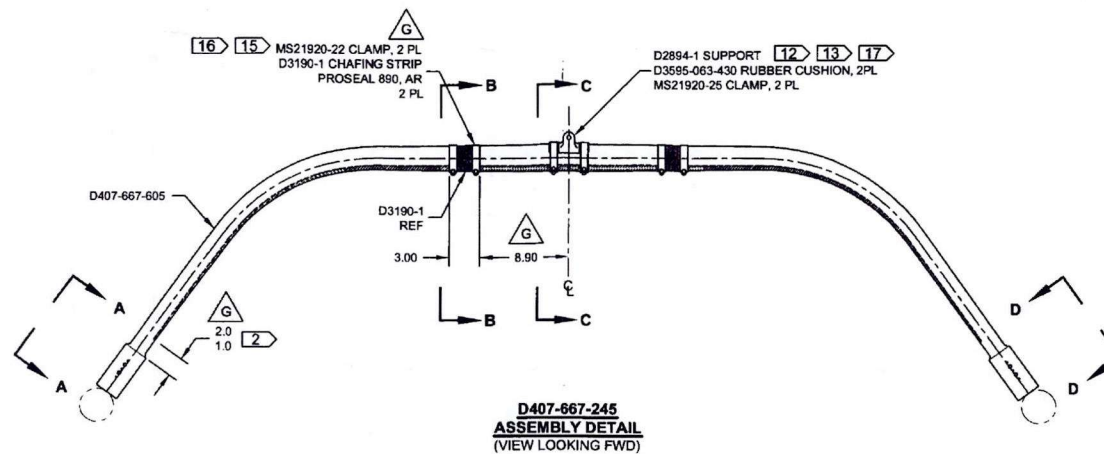

RELEASED
2015 APR 09

DESIGN	4P	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	4P	DRAWING NO.	REV. C
MFG. APPR.	4P	D407-667-245	SHEET 2 OF 4
APPROVED	4P	TITLE	SCALE
DE APPR.	4P	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					


8 7 6 5 4 3 2 1

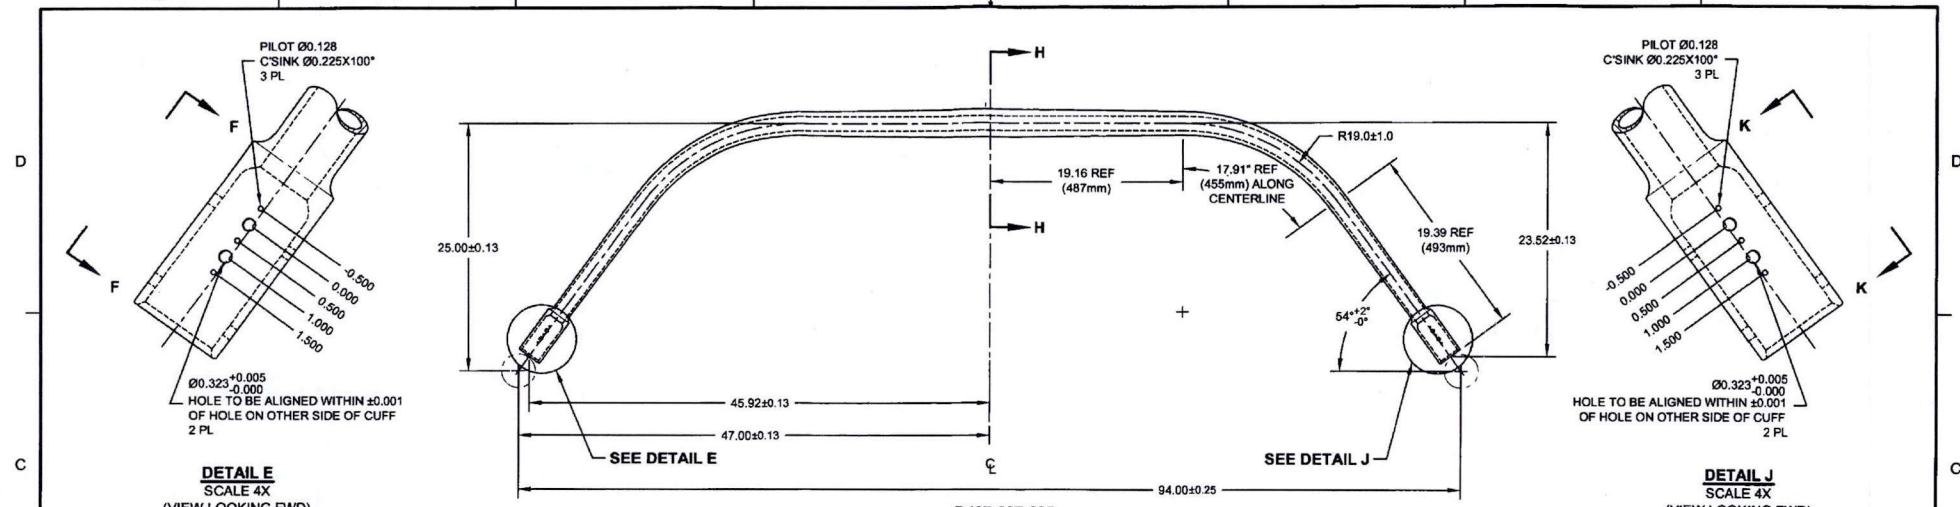

DETAIL E
SCALE 4X
(VIEW LOOKING FWD)

DETAIL J
SCALE 4X
(VIEW LOOKING FWD)

D407-667-605
BENDING AND DRILLING DETAIL
(VIEW LOOKING FWD)

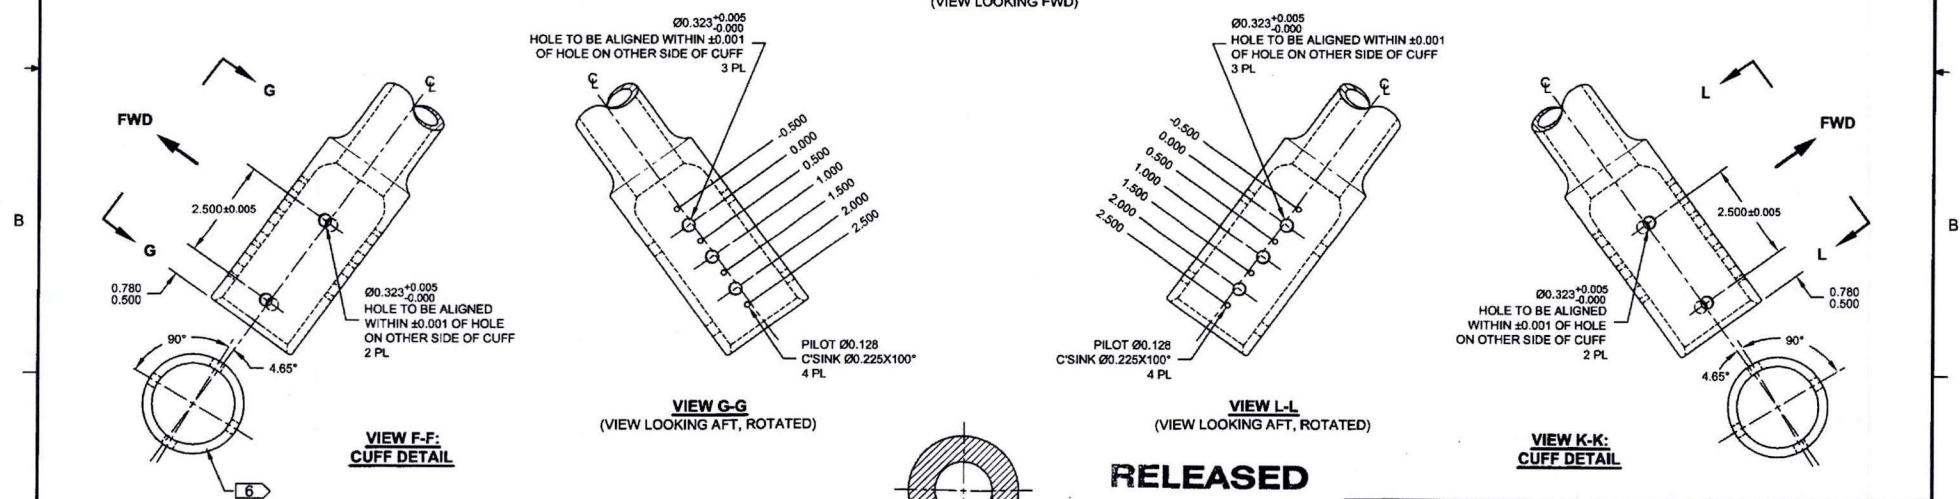


VIEW F-F:
CUFF DETAIL

VIEW G-G
(VIEW LOOKING AFT, ROTATED)

VIEW L-L
(VIEW LOOKING AFT, ROTATED)

VIEW K-K:
CUFF DETAIL

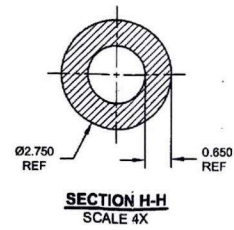

SECTION H-H
SCALE 4X

RELEASED
2015 APR 09

DESIGN	47	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	47	DRAWING NO.	REV. G
MFG. APPR.	47	D407-667-245	SHEET 3 OF 4
APPROVED	47	TITLE	SCALE
DE APPR.	47	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

8 7 6 5 4 3 2 1

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

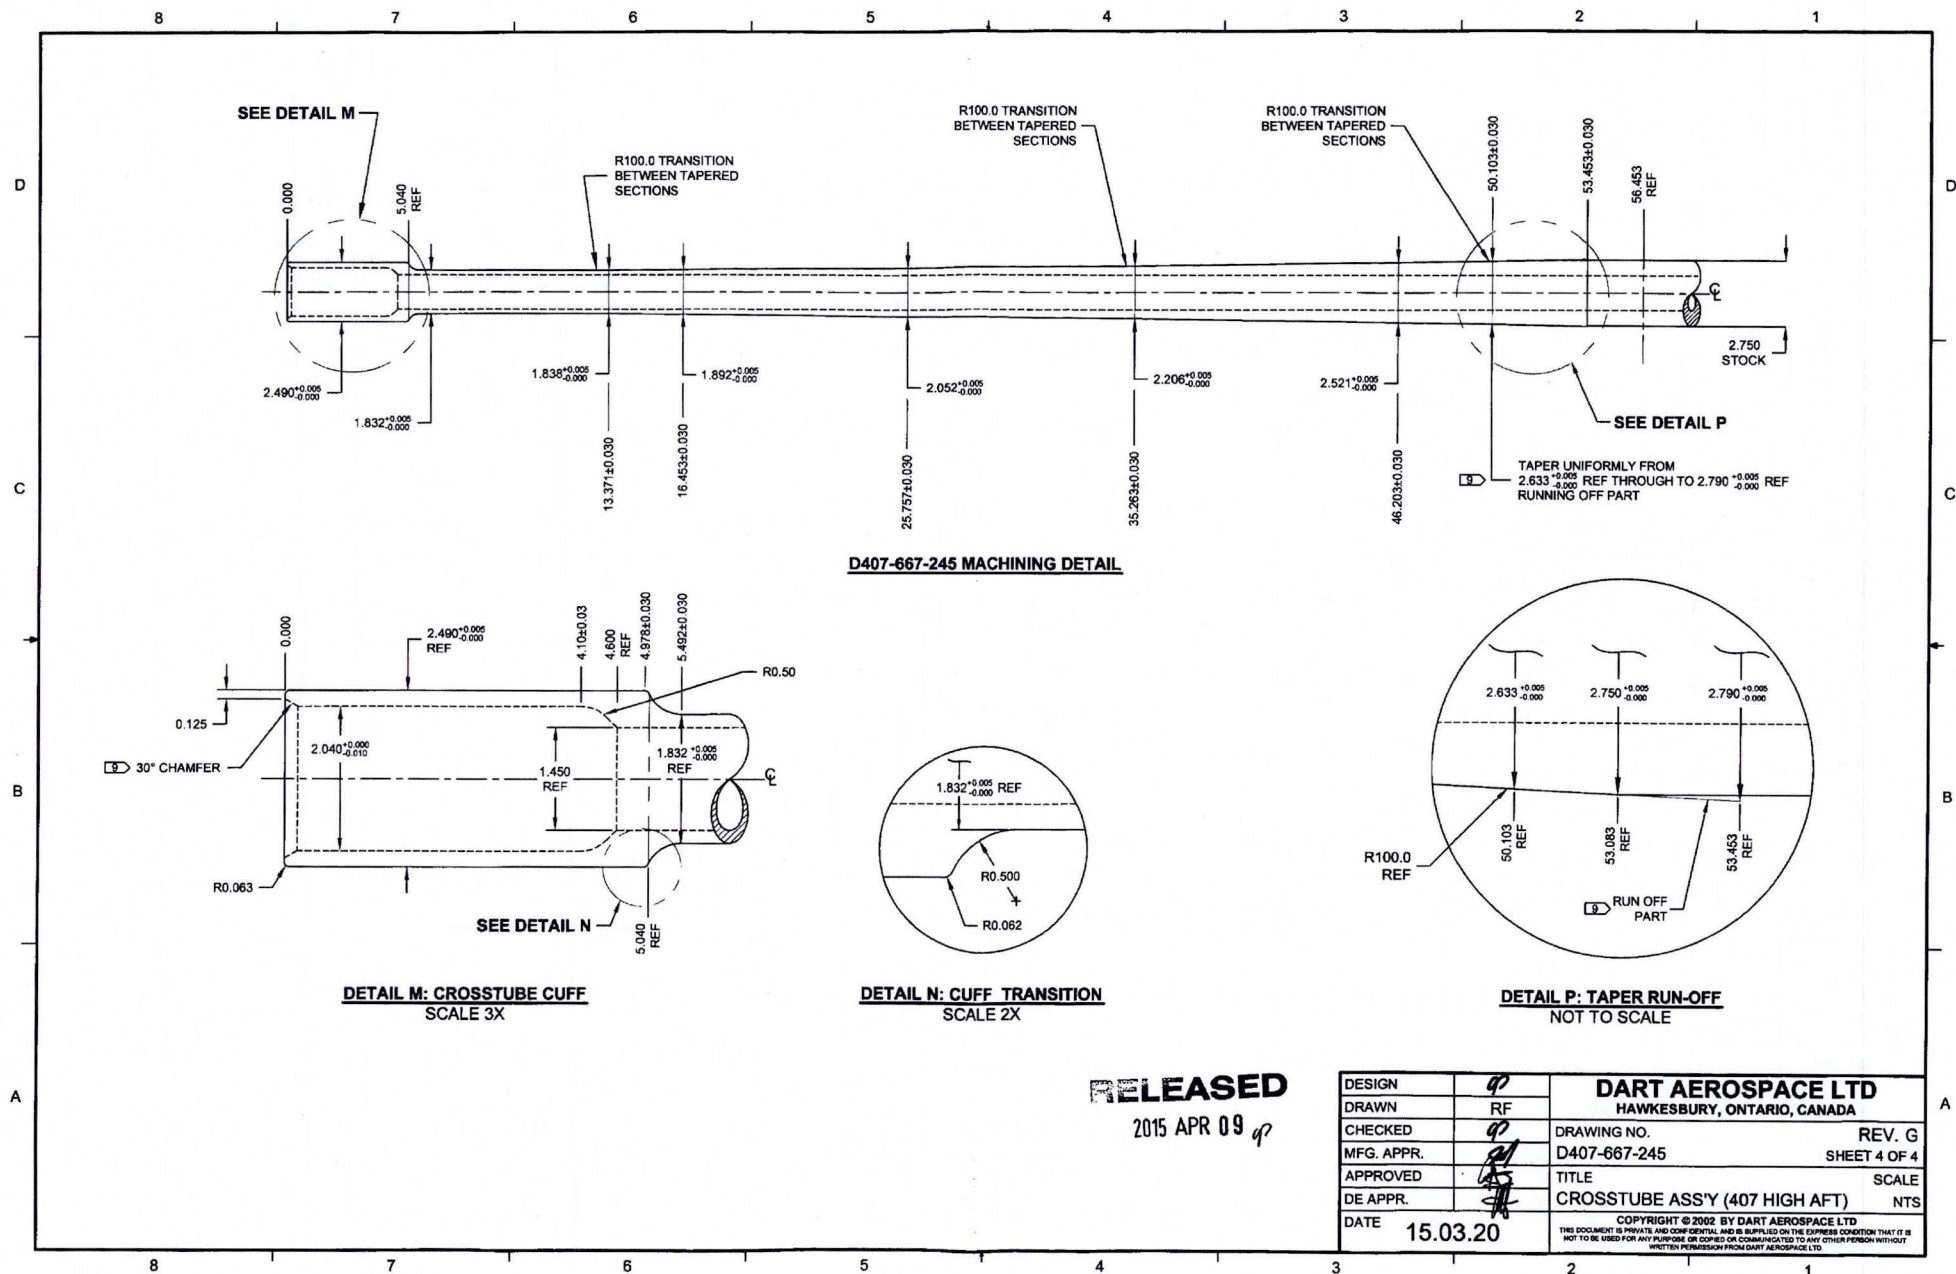

RELEASED
2015 APR 09

DESIGN	Q	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	Q	DRAWING NO.	REV. G
MFG. APPR.	Q	D407-667-245	SHEET 4 OF 4
APPROVED	Q	TITLE	SCALE
DE APPR.	Q	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					